
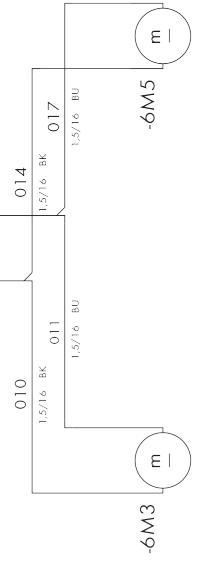
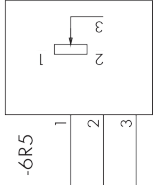



Power Supply
1 ~ 230VAC 50-60Hz/16A

Switch
Off/On

Hour Meter

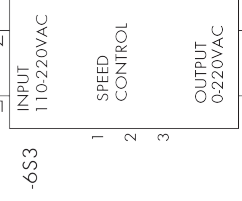


Motor 1
 Speed Control
 Motor 2
 POTENTIOMETER
 2W/350K

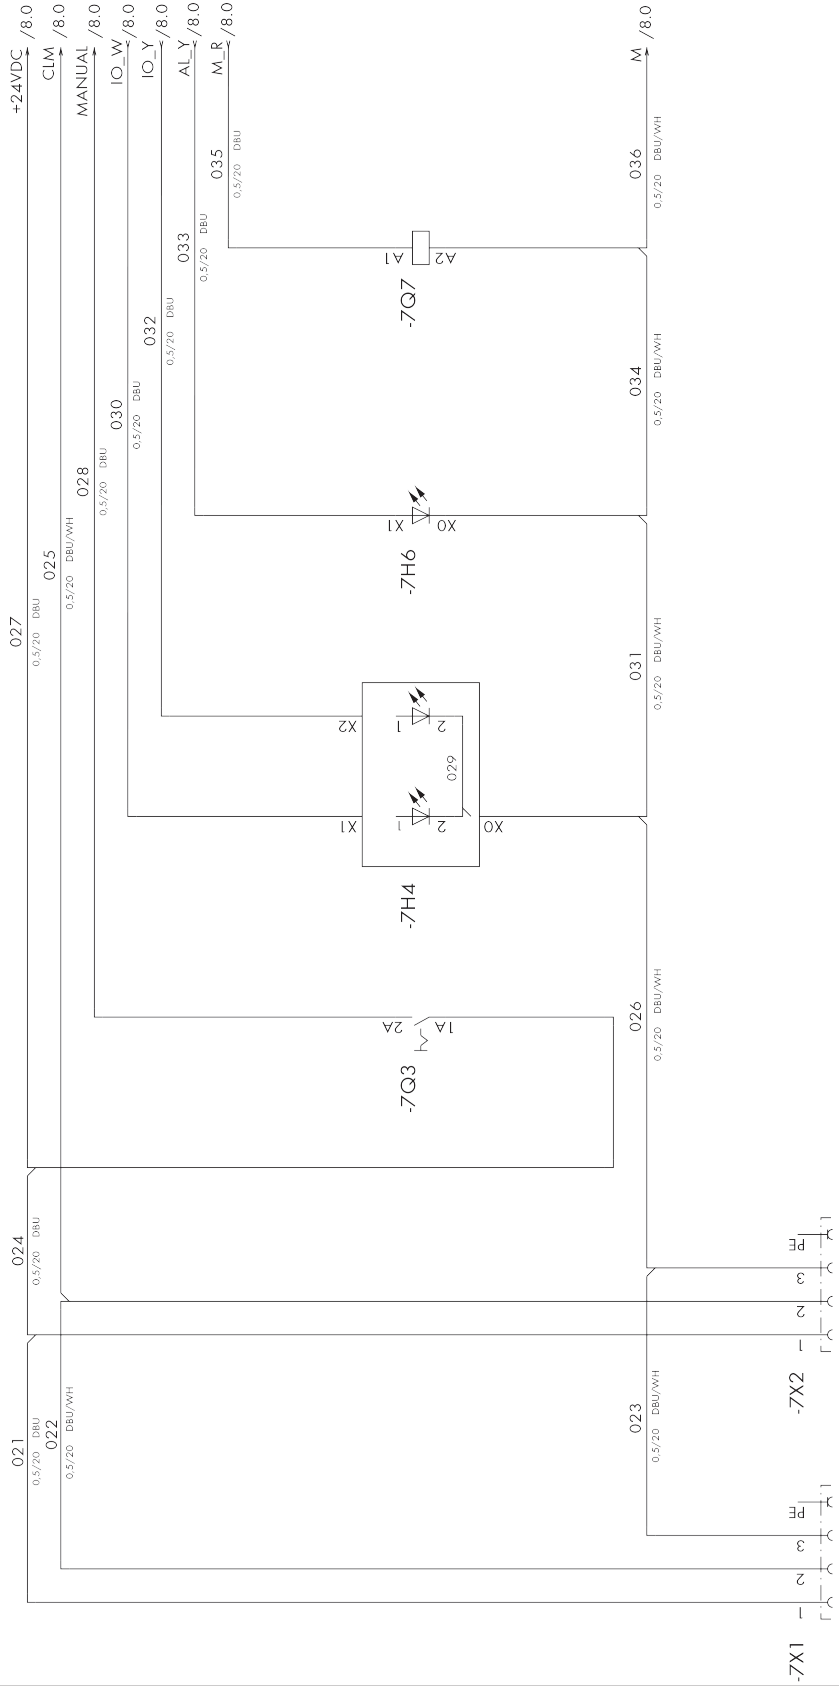

Clamp Meter Clamp Meter Switch Manual/Auto Power On LED White/Green Filter Warning LED Yellow Motor Relay

/6.4 13 14
 /6.4 23 24
 /5.5 43 44
 /5.5 33 34

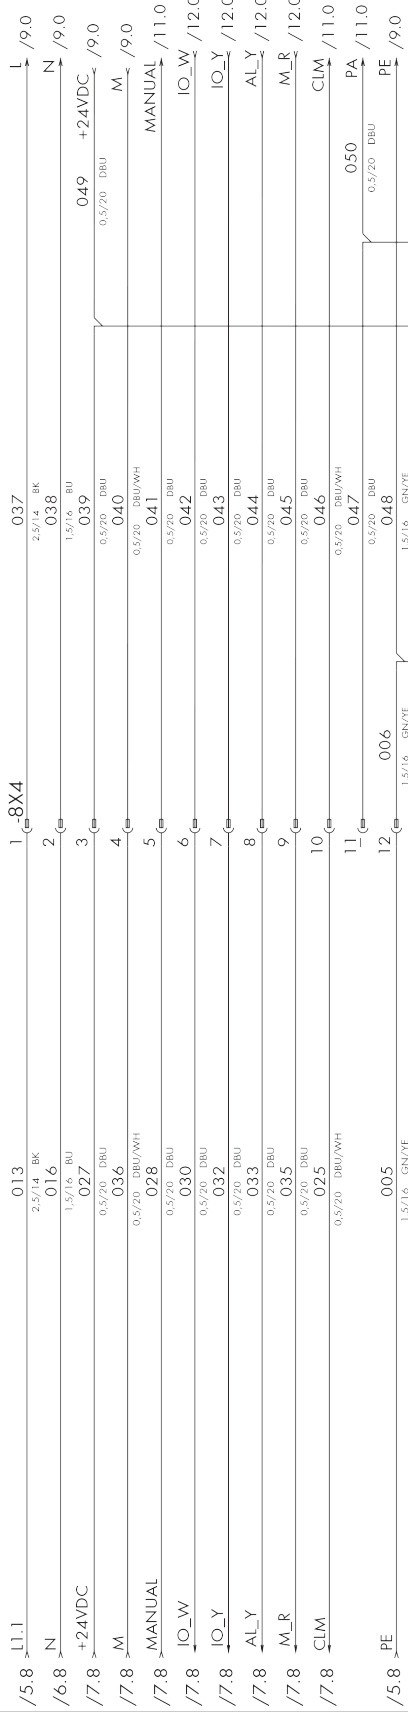


-8X5
CLEANING
CABINET

-8B6



PA Sensor

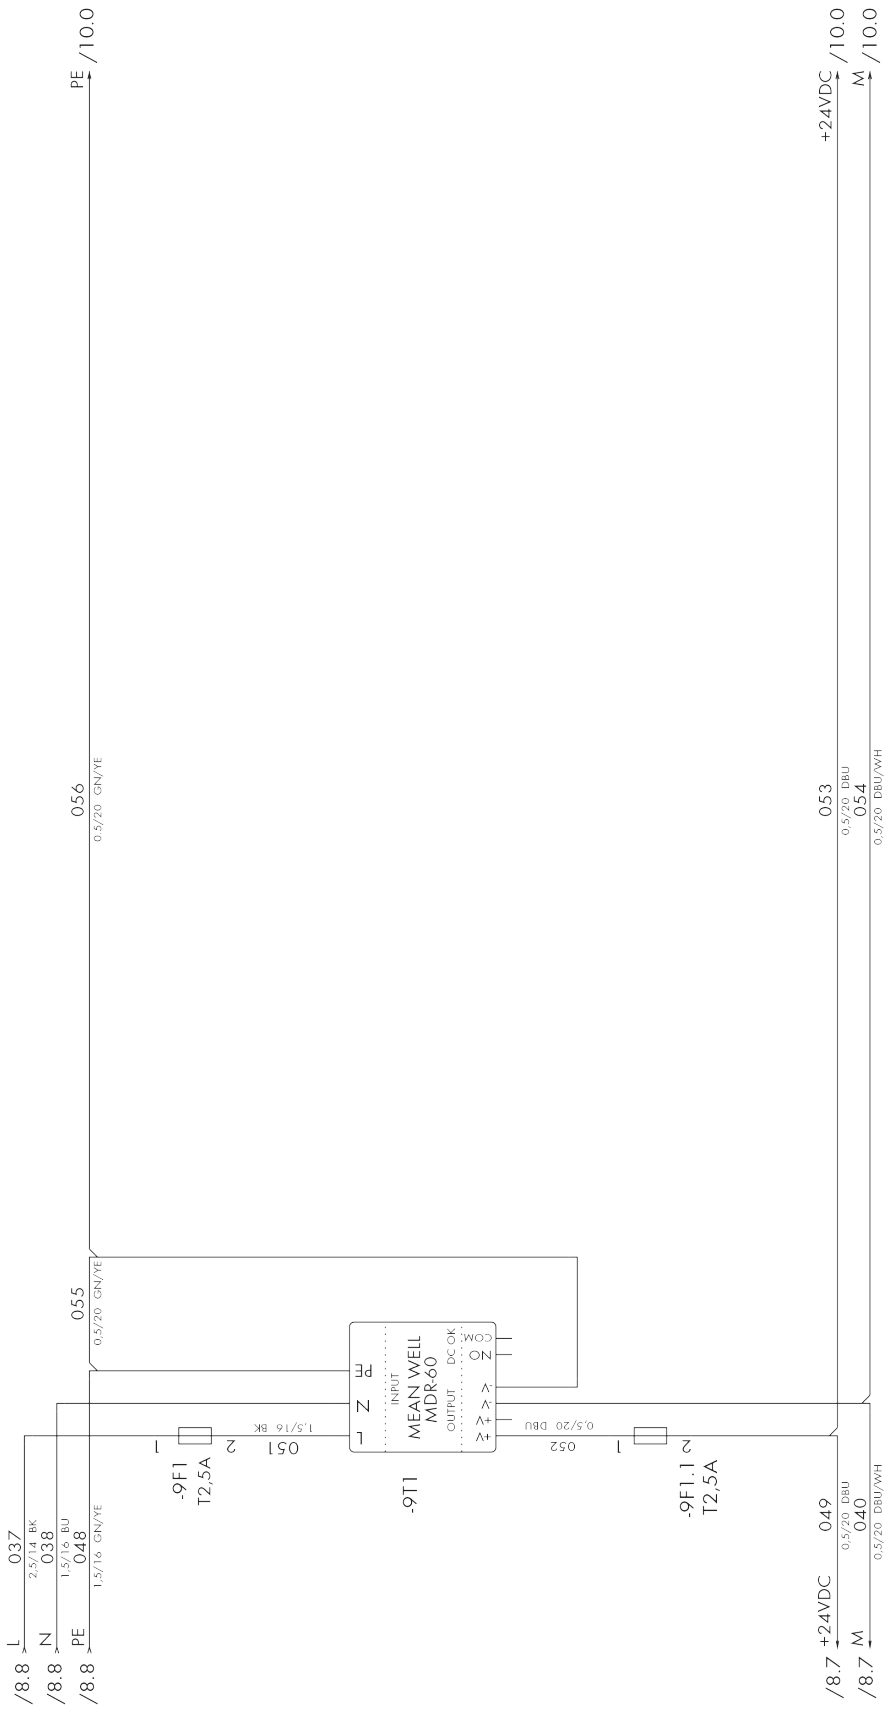

Power Supply Unit 24VDC



-10K2

SIEMENS			S7-200 SMART CPU ST20 12 Input DC 24V 8 Output DC 24V		
X10:2	I0.0	/11.1 Switch Manue=1	X12:3	G0.0	/12.1 LED On
X10:3	I0.1	Auto=0/11.7 Clamp Meter	X12:4	G0.1	/12.2 LED Running
X10:4	I0.2	/11.2 PA Switch	X12:5	G0.2	/12.3 LED Filter Warning
X10:5	I0.3		X12:6	G0.3	/12.4 Motorrelay
X10:6	I0.4		X12:7	G0.4	/12.5 Valve 1 Cleaning
X10:7	I0.5		X12:8	G0.5	/12.7 Valve 2 Cleaning
X10:8	I0.6		X12:9	G0.6	
X11:1	I0.7		X12:10	G0.7	
X11:2	I1.0				
X11:3	I1.1				
X11:4	I1.2				
X11:5	I1.3				
X11:6	M				
X11:7	M				
X11:8	M				
X10:1	FE				
X12:1	M				
X12:2	2M				
X12:11	+				
X12:12	M				

/10.8 → +24VDC 061
0.5/20 DBU

/8.8 → CLM 046
0.5/20 DBU/WH

/8.8 → PA 050
0.5/20 DBU

/8.8 → MANUAL 041
0.5/20 DBU



063
0.5/20 DBU

-11K5
/11.5

064
0.5/20 DBU

-11K5
A1 A2

-X10:3

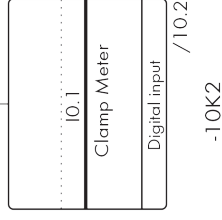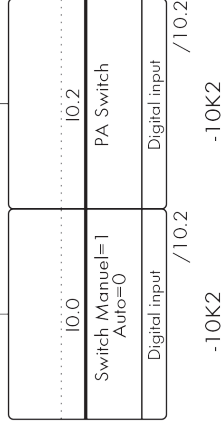

Relay Clamp Meter

/11.7 13 → 14